


| SPECIFICATION | CONNECTION | BIPOLAR |
|---|------------|------------------------------|
| AMPS/PHASE | | 1.00 |
| RESISTANCE/PHASE(Ohms)@25°C | | 3.20±10% |
| INDUCTANCE/PHASE(mH)@1KHz | | 4.50±20% |
| HOLDING TORQUE w/o GEARBOX(Nm)[lb-in] | | 0.14[1.24] |
| GEAR RATIO | | 5 ₁₁ ² |
| EFFICIENCY | | 90.00% |
| STEP ANGLE w/o GEARBOX(°) | | 1.80 |
| BACKLASH@NO-LOAD | | <=1° |
| MAX.PERMISSIBLE TORQUE(Nm) | | 2.00 |
| MOMENT PERMISSIBLE TORQUE(Nm) | | 4.00 |
| SHAFT MAXIMUM AXIAL LOAD(N) | | 50.00 |
| SHAFT MAXIMUM RADIAL LOAD(N) | | 100.00 |
| WEIGHT(Kg)[lb] | | 0.40[0.88] |
| TEMPERATURE RISE:MAX.80°C (MOTOR STANDSTILL;FOR 2PHASE ENERGIZED) | | |
| AMBIENT TEMPERATURE -10°C~50°C[14°F~122°F] | | |
| INSULATION CLASS B 130°C[266°F] | | |

| TYPE OF CONNECTION (EXTERN) | | MOTOR | |
|-----------------------------|---------|-------|---------|
| PIN NO | BIPOLAR | LEADS | WINDING |
| 1 | A — | RED | A |
| 2 | A\ — | GRN | A\ |
| 3 | B — | YEL | B |
| 4 | B\ — | BLU | B\ |

FULL STEP 2 PHASE-Ex.,
WHEN FACING MOUNTING END (X)

| STEP | A | B | A\ | B\ | | CCW |
|------|---|---|----|----|---|-----|
| 1 | + | + | - | - | ↓ | ↑ |
| 2 | - | + | + | - | | |
| 3 | - | - | + | + | ↑ | ↓ |
| 4 | + | - | - | + | | |

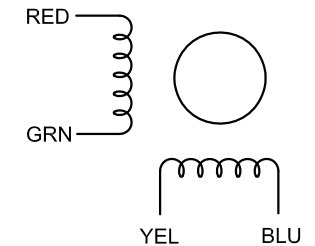

STEPPERONLINE®

| | | |
|-------|-----------|-----------|
| APVD | | 8.18.2018 |
| CHKD | | |
| 1:1 | DRN | |
| SCALE | SIGNATURE | DATE |

STEPPER MOTOR

14HS13-0804S-PG5